

Work Order ID 161183***161183***

Page 1

Monday, May 08, 2017 10:16:09 AM

Item ID: D206-667-147TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/18/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/25/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED/C

Approvals: Process Plan:  Date: **MAY 08 2017**

Tooling:

Date:

Run Start ***NR1***

QC: Date: SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D206-667-147	A								

100

1.08

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

1.80

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs 206-147 on both ends as per Folio FB029

2-Turn first side as per Folio FB029

3-Blend transition lines only with belt sander 60 grit.

FOLIO REV: AADWG REV: AA

1

DAS
23
9-89

17/5/11

110

0.00

110

QC

Quality Control

QC2- Inspect parts off machine FAI/FAIB

Memo

0.00

1

DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 161183

Monday, May 08, 2017 10:16:10 AM

161183

Page 2

Item ID: D206-667-147TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/18/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/25/2017 Req'd Qty: 1.00

1

Customer:



Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

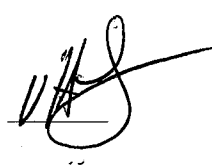Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	MORI SEIKI CNC LATHE LARGE	0.00				1	0		
120									
Mori Seiki	Memo	0.00							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FB029								
	2-Blend transition lines only with belt sander 60 grit.								
	3-Remove sand and plugs								
	FOLIO REV: <u>AA</u>								
	DWG REV: <u>A</u>								
130	QC2- Inspect parts off machine FAI/FAIB	0.00				1	0		
130									
QC	Memo	0.00							
Quality Control									
140	QC8- Inspect parts - second check	0.00				1	0		
140									
QC	Memo	0.02							
Quality Control									

DAS
47

9-89

17-05-16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 161183

Monday, May 08, 2017 10:16:10 AM

161183

Page 3

Item ID: D206-667-147TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/18/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/25/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

145

0.00

145

Crosstubes

Memo

0.27

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

002 17-05-16

150

0.00

150

HandFXtube

Memo

2.60

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED
SCOTCH BRITE(11) 20170622
BEB

160

QC7-Inspect Chemical Conversion Coat

0.00

160

QC

Memo

0.02

Quality Control

1 47
17-06-26
DAS
9-89

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 161183

Monday, May 08, 2017 10:16:10 AM

161183

Page 4

Item ID: D206-667-147TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/18/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/25/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170		0.00							DAS
170	Packaging					1	0		47
Packaging	Memo	0.00							9-89
Packaging	LOCATION : LG014								17-06-26
180	QC21- Final Inspection - Work Order Release	0.00							
180									17/6/27
QC	Memo	0.10							
Quality Control									



JUN 26 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER : ☐						
Misidentified ☐	☐	Past Due ☐							

Picklist Print

Monday, May 08, 2017 10:16:09 AM

Page 1

Work Order ID: 161183

161183

Parent Item: D206-667-147TRN

D206-667-147TRN

Parent Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/18/2017

Required Date: 5/25/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP rev:A 11.01.06 new issue DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6002-115		Manufactured	No			100	Each	66.0000	1	1			

D6002-115

Crosstube Material

Location

Loc Qty

Loc Code

HALL

60

107867

60

LG003

6

69794

6

17/5/11

DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td style="border: none;"></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐				Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐				Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐				Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐											
OTHER : ☐																									


DART AEROSPACE LTD	Work Order:	161183
Description: Crosstube Assembly, Mid Fwd	Part Number:	D206-667-147
Inspection Dwg: D206-667-147 Rev: A		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.243	✓		↑	
	1.984	+0.005/-0.000	1.987	✓			
	2.019	+0.005/-0.000	2.023	✓			
	2.058	+0.005/-0.000	2.063	✓			
	2.097	+0.005/-0.000	2.101	✓			
	2.136	+0.005/-0.000	2.137	✓			
	2.176	+0.005/-0.000	2.179	✓			
	0.125	+/-0.010	0.125	✓		Vernier	
	R0.063	+/-0.010	R0.063	✓		RG	
	R2.00	+/-0.010	R2.00	✓		RG	
	R0.063	+/-0.010	R0.063	✓		RG	
	4.438	+/-0.030	4.438	✓		tape	
SIDE B	2.240	+0.005/-0.000	2.244	✓		↑	
	1.984	+0.005/-0.000	1.988	✓			
	2.019	+0.005/-0.000	2.023	✓			
	2.058	+0.005/-0.000	2.063	✓			
	2.097	+0.005/-0.000	2.099	✓			
	2.136	+0.005/-0.000	2.137	✓			
	2.176	+0.005/-0.000	2.178	✓			
	0.125	+/-0.010	0.125	✓		Vernier	
	R0.063	+/-0.010	R0.063	✓		RG	
	R2.00	+/-0.010	R2.00	✓		RG	
	R0.063	+/-0.010	R0.063	✓		RG	
	4.438	+/-0.030	4.438	✓		tape	
	99.84	+/-0.020	99.84	✓		tape	

DART AEROSPACE LTD	Work Order:	
Description: Crosstube Assembly, Mid Fwd	Part Number:	D206-667-147
Inspection Dwg: D206-667-147 Rev: A		Page 2 of 2

WALL THICKNESS MEASUREMENT

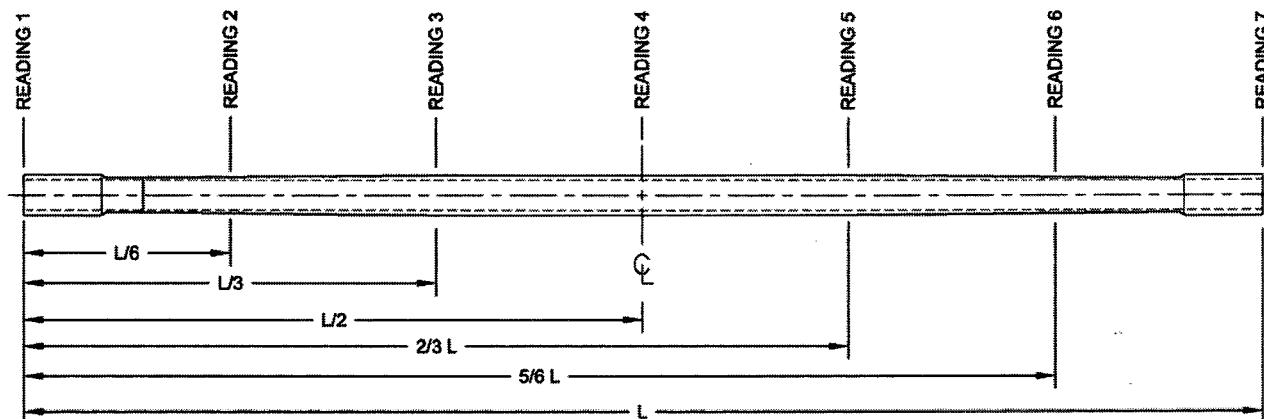

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	245	260	268	255	0.023	0.035"
READING 2 L= 16.64	164	175	184	173	0.020	
READING 3 L= 33.28	244	253	264	256	0.020	
READING 4 L= 49.92	249	257	268	261	0.019	
READING 5 L= 66.56	243	250	260	256	0.017	
READING 6 L= 83.2	162	171	184	175	0.022	
READING 7 L= 99.84	245	257	268	258	0.023	

Calibration Result

Actual Block Thickness: 100-250

Sitescan 250 Measured Thickness: 100-250

**DAS
23**

**DAS
47**

9-89

9-89

Measured by:	9-89
Date:	17/5/15

Audited by:	9-89
Date:	17-05-16

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised by	Approved
B	11.06.21	New Issue	KJ	
C	12.06.04	Wall thickness form added	KJ	

Item	Qty -147	Part Number	Description
1	X	D206-667-147	CROSSTUBE ASSEMBLY (206L MID FWD)
2	1	D6002-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6002-115
FINISHED LENGTH = 99.84±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-147" AND BATCH NUMBER ON
INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS).
- 7) WEIGHT: 15.0 lbs (-507 = 12.84)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI
015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 1161183
MAY 9 8 2017

DEO ATTACHED

EW 11-605
11.07.28


UNDER REVIEW

RELEASED
2011-05-23
JN


A	NEW ISSUE	CP	10.11.23
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	10.12.23		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D206-667-147	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASSY (206L MID FWD)	SCALE NTS
COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED BY THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

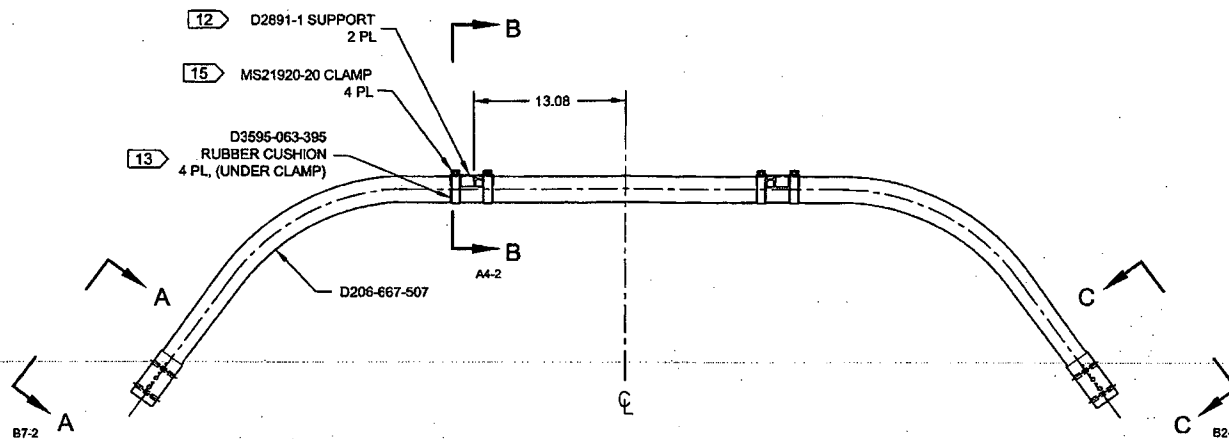


D206-667-147
ASSEMBLY DETAIL
(VIEW LOOKING FWD)

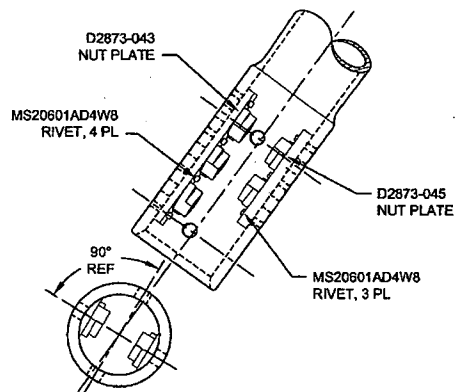

VIEW A-A:
CUFF DETAIL
SCALE 4X

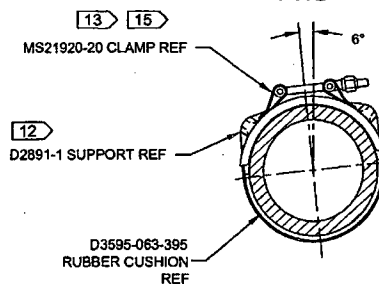

SECTION B-B
SCALE 5X

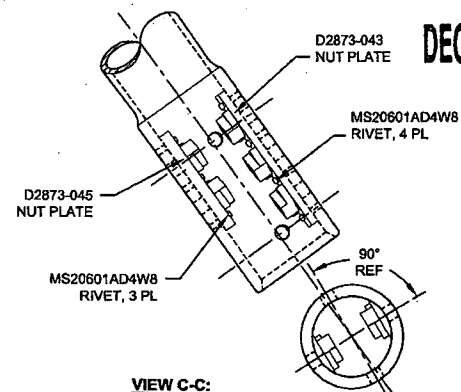

VIEW C-C:
CUFF DETAIL
SCALE 4X


ECN #1.615
11.07.28

UNDER REVIEW

RELEASED
2011-05-24

DEO ATTACHED

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.		D206-667-147	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L MID FWD)	NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS BURNED ON THE CORRESPONDING SHEET THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

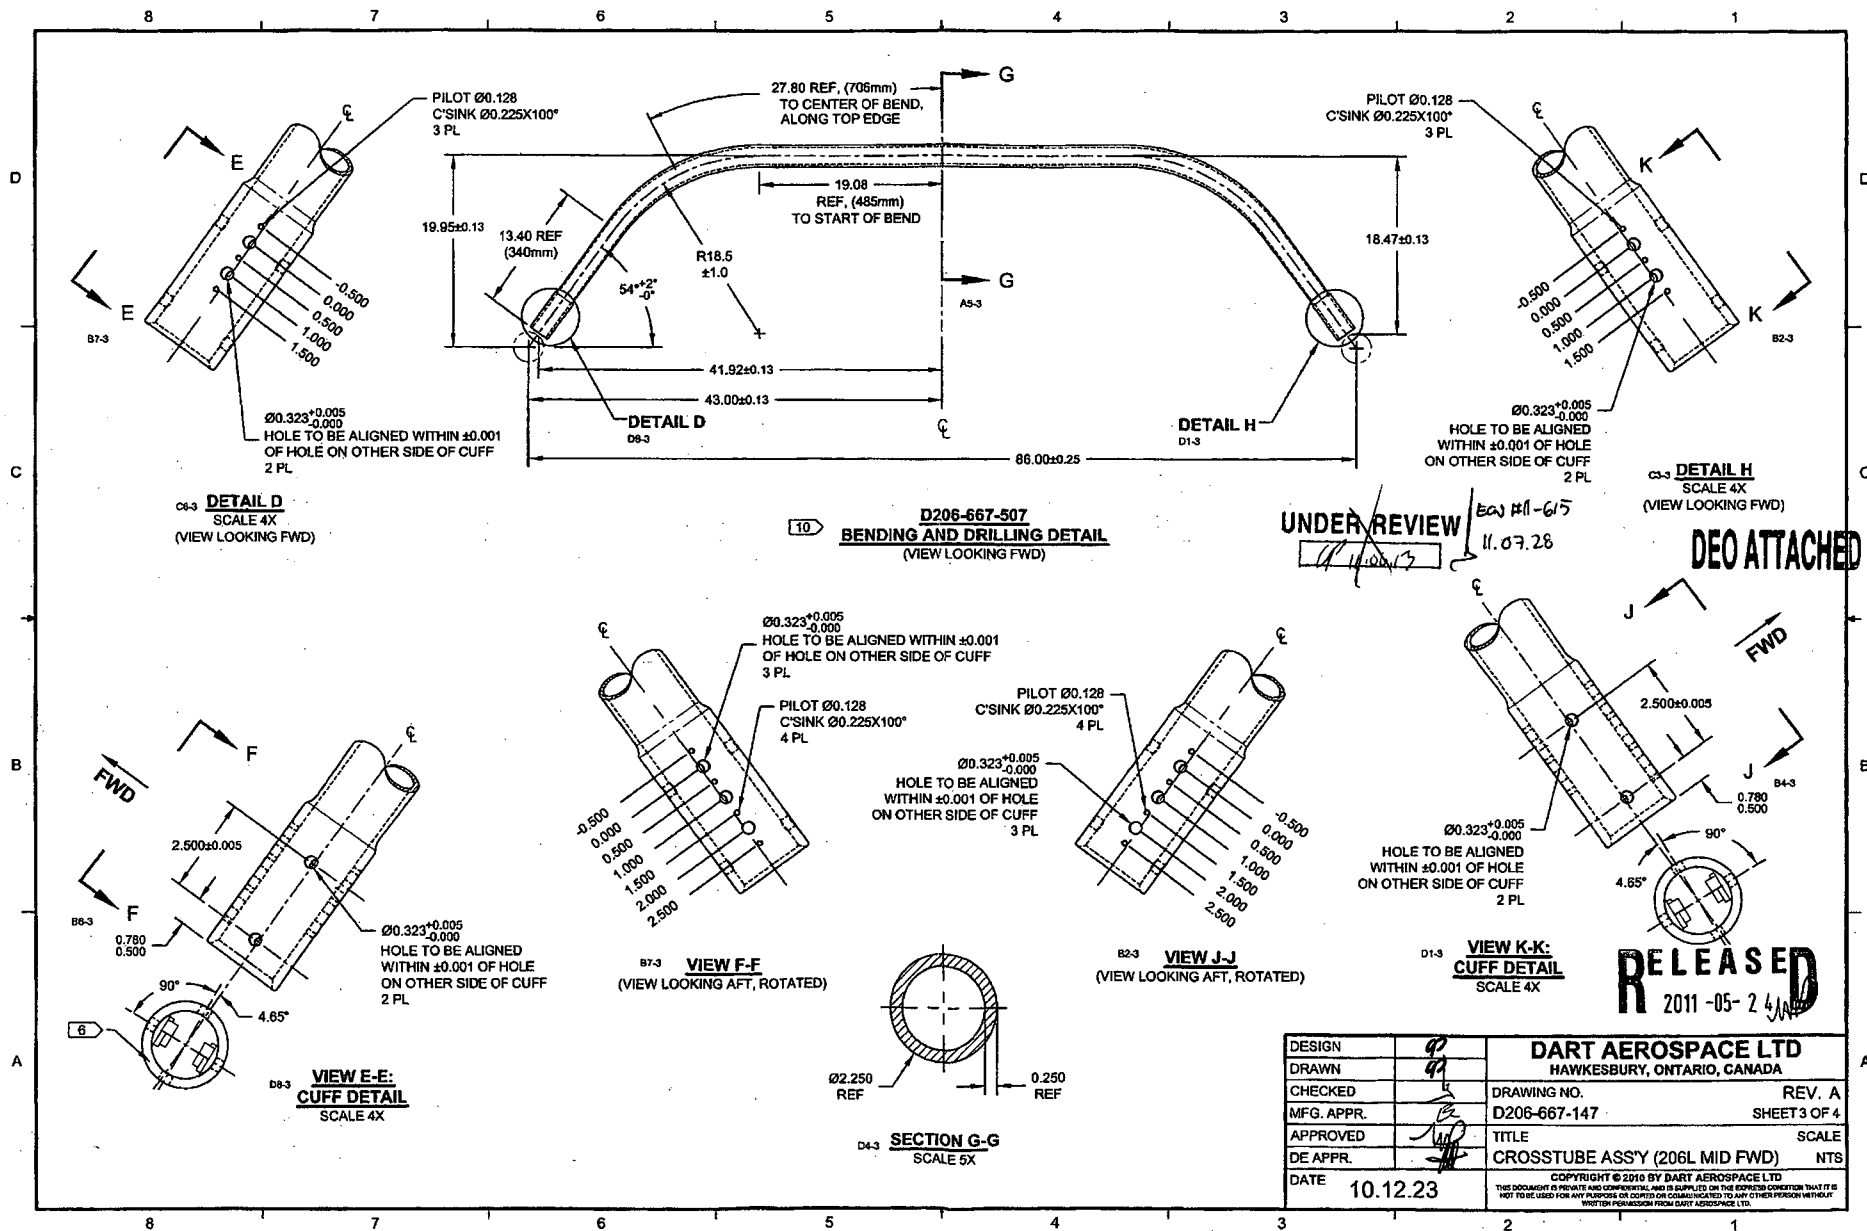


8 7 6 5 4 3 2 1

D

C

B

A

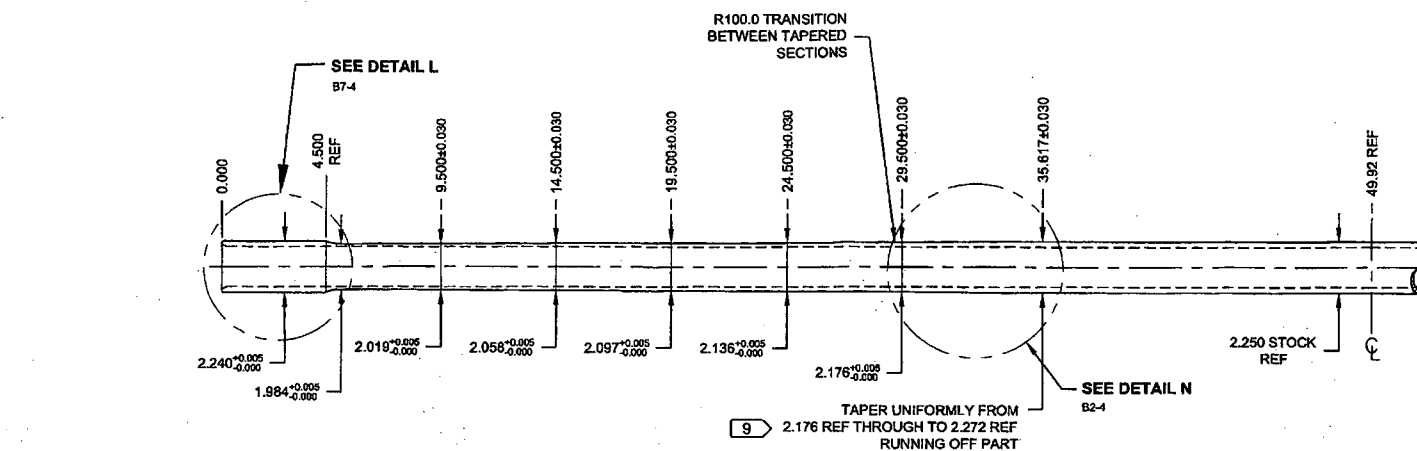


UNDER REVIEW

11.06.13


ECN # 11-615
11.07.28

TURNING DETAIL


DEO ATTACHED

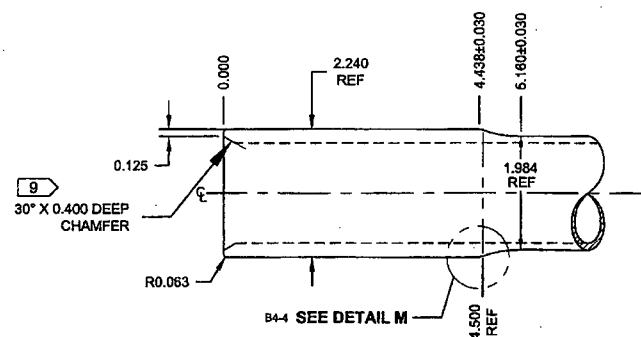

DETAIL L:
D7-4 CROSSTUBE CUFF
NOT TO SCALE

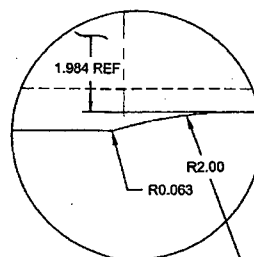

DETAIL M:
A6-4 CUFF TRANSITION
NOT TO SCALE

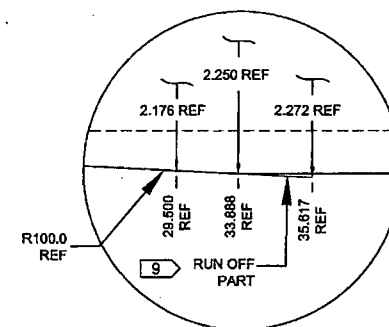

DETAIL N:
C4-4 TAPER RUN-OFF
NOT TO SCALE

RELEASED
2011-05-23

DESIGN	9	DART AEROSPACE LTD	
DRAWN	9	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.		D206-667-147	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L MID FWD)	NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR COMMERCIAL PURPOSES WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DRAWING NO. D206-667-147	TITLE CROSSTUBE ASS'Y (206L MID FWD)	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D206-667-147-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>92</i>	CHECKED <i>ADS</i>	MFG. APPR. <i>JD</i>	APPROVED <i>MD</i>		DE APPR. <i>MD</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11.07.21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -147	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

12) TO INSTALL D2891-1 SUPPORT: ABRABE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.

15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.

15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28

DRAWING NO. D206-667-147	TITLE CROSSTUBE ASS'Y (206L MID FWD)	REV. A	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D206-667-147-A-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN AJS	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	

PURPOSE:

ADD ELECTRICAL GROUNDING STRAP

CHANGE:


PARTS LIST:

ITEM	QTY -147	PART NUMBER	DESCRIPTION
1	X	D206-667-147	CROSSTUBE ASSEMBLY (206L MID FWD)
10	2	AN742D36	CLAMP
11	2	MS9165-05	ANGLE BRACKET
12	2	MS21042L3	NUT (OR MS21042-3)
13	2	MS27039-1-08	SCREW
14	4	NAS1149C0332R	WASHER (OR AN960C10L)


GENERAL NOTES:

- 16) MASK AREA UNDER CLAMP PRIOR TO PAINTING
- 17) SEAL EDGES WHERE AN742D36 CLAMP MEETS WITH THE CROSSTUBE USING SIKAFLEX-241/-291 OR MIL-S-8802 CLASS B2 OR PROSEAL 890 SEALANT
- 18) PERFORM RESISTANCE CHECK TO ENSURE MAX RESISTANCE IS 10 MILLIOHMS

→ AFT

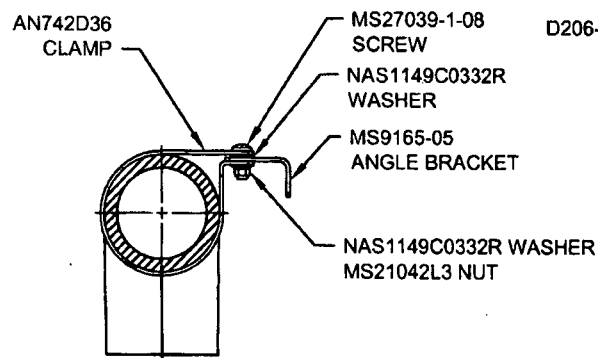

SECTION R-R

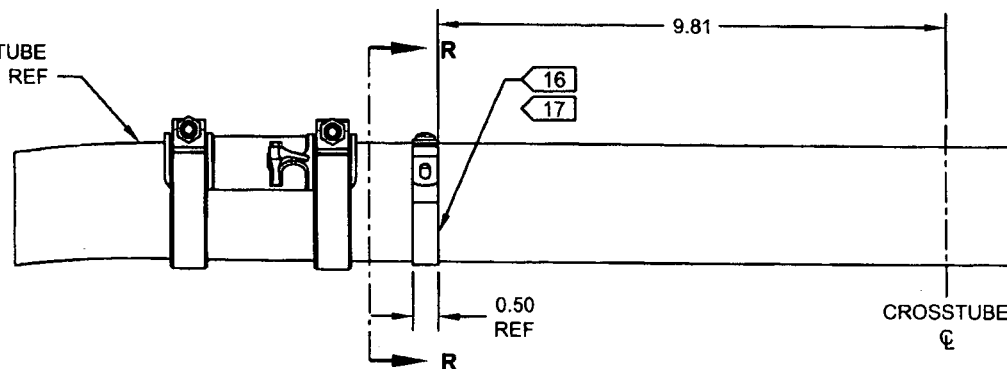

DETAIL P
BONDING STRAP INSTALLATION 2 PL

RELEASED
UP 12.08.17
ECN 12-431

COPYRIGHT © 2012 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

